


ILS RWY 30L (SA CAT I & II)
NORMAN Y MINETA SAN JOSE INTL (SJC)



MISSED APPROACH: Climb to 1900 on SJC VOR/DME R-303 to ARTAQ INT/SJC 7 DME and hold

D-ATIS 126.95	NORCAL APP CON 120.1 290.25	SAN JOSE TOWER ★ 124.0 (CTAF) 0 257.6	GND CON 121.7	CLNC DEL 118.0	CPDLC	UNICOM 122.95
-------------------------	---------------------------------------	--	-------------------------	--------------------------	-------	-------------------------

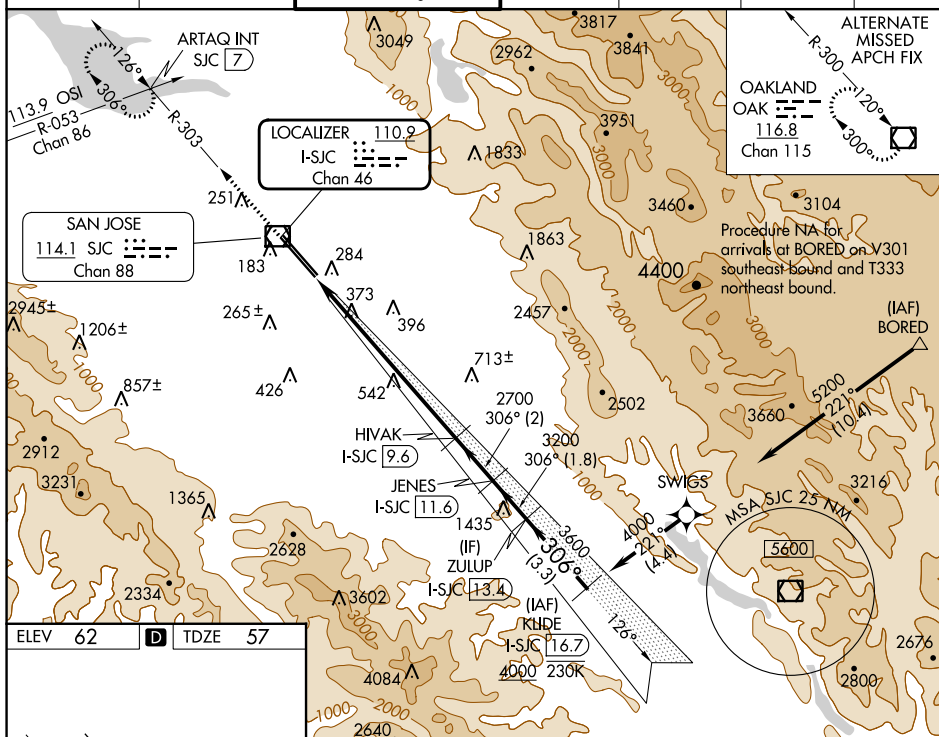

S-ILS 30L

ARTAQ INT
JENES I-SJC 11.6
ZULUP I-SJC 13.4
KLIDE I-SJC 16.7

VGSI and ILS glidepath not coincident
(VGSI Angle 3.00/TCH 70).

CATEGORY	A	B	C	D
S-ILS 30L	SA CAT I	RA 147/14	150 DA 207	
S-ILS 30L	SA CAT II	RA 97/12	100 DA 157	

SA CATEGORY I & II ILS - SPECIAL AIRCREW
AND AIRCRAFT CERTIFICATION REQUIRED

NORMAN Y MINETA SAN JOSE INTL (SJC)
ILS RWY 30L (SA CAT I & II)